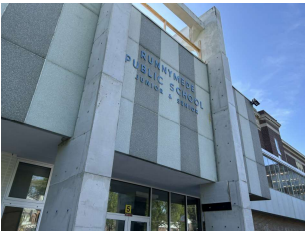


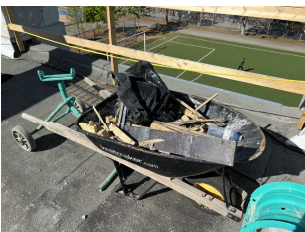
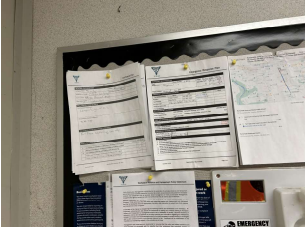
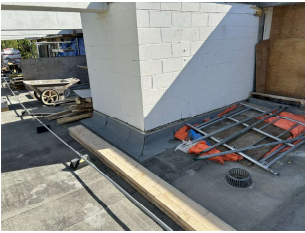





Site Safety Inspection Report



Safety Design Strategies - 410 Chrislea Road, Unit #13, Woodbridge, ON L4L 8B5 - 905-264-7233 - www.sds-safety.com

Company Toronto District School Board	Location/Address 357 Runnymede Road, High Park North, Old Toronto, Toronto, Ontario, M6P 3C5, Canada		
Date May 20, 2025	Time In: 8:30 AM	Time Out: 10:30 AM	Weather Few Clouds, 12°C, 9 km/h Winds
Project	Supervisor TCM - Cillian	Safety Inspector Mike Harrison	Title TDSB Site Inspection Report for Runnymede JSPS at 357 Runnymede Rd Project May 20, 2025

Item #	Act / Reg / Follow-Up	Observations
1. 	Item Site Information INFO Regulation Site Information INFO Action N/A	SDS arrived on site at 8:30am to observe the construction work being performed at Runnymede JSPS and how the work is effecting the school and its occupants. Discussed site conditions with Cillian. Observed four workers on site and work consists of preparation for concrete pour on the roof.
2. 	Item Full Scaffold Platforms Regulation #135 (1)(b) (213/91) Action N/A	Observed that a scaffold platform that is 2.4 meters or more above a floor, roof, or surface consists of planks laid tightly side by side for the full width of the scaffold, which meets compliance.
3. 	Item Scaffolding - Footings, Sills, Supports Regulation #128 (1)(c) (213/91) Action Issue Corrected	Per previous report, observed that the footings, sills and supports of the scaffolding are now on level ground and secured, which meets compliance.
4. 	Item Housekeeping Regulation #35 (1) (213/91) Action On-Going	Observed waste materials and debris being removed to waste disposal containment areas/bins at least daily, which meets compliance.

Item #	Act / Reg / Follow-Up	Observations
5.	 <p>Item Fire Extinguisher - Flammables/Combustibles Regulation #52 (2)(a) (213/91) Action Issue Corrected</p>	Observed fire extinguishing equipment is not available where flammable liquids/combustibles are being stored/handled/used. Discussed the issue with the supervisor and fire extinguishing equipment was then available where flammable liquids/combustibles are being stored/handled/used, which meets compliance.
6.	 <p>Item Constructor - ERP Posting Regulation #17 (3) (213/91) Action N/A</p>	Observed that an emergency response plan was posted on the site and is readily available to the workers, which meets compliance.
7.	 <p>Item Material Storage Regulation #39 (213/91) Action Issue Corrected</p>	Per previous report, observed scaffolding and other materials on site now being stored in a manner to prevent tipping, collapsing or rolling as to not endanger a worker, which meets compliance.
8.	 <p>Item Access / Egress - Emergencies Regulation #71 (213/91) Action Issue Corrected</p>	Per previous report, observed access/egress travel routes are now clear of materials and debris for workers to exit in the event of an evacuation, which meets compliance.
9.	 <p>Item Bump Lines Regulation #207 (1) (213/91) Action Issue Corrected</p>	Per previous report, observed that adequate barriers are now erected in the work area at least 2 meters from the perimeter of the roof, which meets compliance.
10.	 <p>Item Scaffolding - Access Means Regulation #135 (1)(d) (213/91) Action Issue Corrected</p>	Observed scaffolding being used on site that does not have a means of access/egress. Discussed the issue with the supervisor and an adequate means of access/egress was then provided, which meets compliance.

Item #	Act / Reg / Follow-Up	Observations
11. 	Item Scaffolding - Bracing Regulation #128 (1)(a) (213/91) Action N/A	Observed that the uprights of the scaffolding have been braced diagonally in the horizontal and vertical planes to prevent lateral movement, which meets compliance.

 TCM - Cillian	 Mike Harrison
<p>The INSPECTOR believes the information contained within this risk assessment report to be correct at the time of reporting. The INSPECTOR does not accept responsibility for any consequences arising from the use of the information herein. The report is based on matters which were observed or came to the attention of the INSPECTOR during the day of the assessment and should not be relied upon as a final record of all possible risks or hazards that may exist or potential improvements that can be made. It is recommended that all health and safety concerns noted on this report be reviewed and addressed by the client's project Supervisor.</p>	