





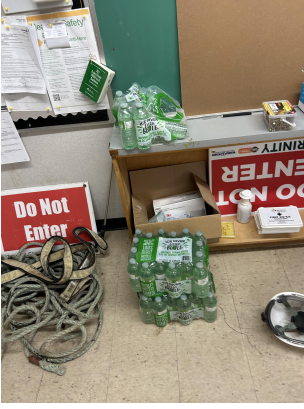







# Site Safety Inspection Report

Safety Design Strategies - 410 Chrislea Road, Unit #13, Woodbridge, ON L4L 8B5 - 905-264-7233 - [www.sds-safety.com](http://www.sds-safety.com)

Company Toronto District School Board	Location/Address 357 Runnymede Road, High Park North, Old Toronto, Toronto, Ontario, M6P 3C5, Canada		
Date April 7, 2025	Time In: 8:30 AM	Time Out: 10:30 AM	Weather Clear Sky, 3°C, 5 km/h Winds
Project	Supervisor TCM - Cillian	Safety Inspector Mike Harrison	Title TDSB Site Inspection Report for Runnymede JSPS at 357 Runnymede Rd Project Apr 7, 2025


Item #	Act / Reg / Follow-Up	Observations
1. 	<b>Item</b> Site Information INFO <b>Regulation</b> Site Information INFO <b>Action</b> N/A	SDS arrived on site at 8:30am to observe the construction work being performed at Runnymede JSPS and how the work is effecting the school and its occupants. Observed four workers on site and work consists of chipping and tarping on the roof.
2. 	<b>Item</b> Signage <b>Regulation</b> #44 (1) (2) (213/91) <b>Action</b> N/A	Observed that signage containing the word DANGER is posted in prominent areas and in sufficient numbers to warn workers and the public of the hazards on site, which meets compliance.
3. 	<b>Item</b> Housekeeping <b>Regulation</b> #35 (1) (213/91) <b>Action</b> On-Going	Observed waste materials and debris being removed to waste disposal containment areas/bins at least daily, which meets compliance.
4. 	<b>Item</b> Scaffolding - Access Means <b>Regulation</b> #135 (1)(d) (213/91) <b>Action</b> N/A	Observed an adequate means of access/egress to the scaffolding is available, which meets compliance.

Item #	Act / Reg / Follow-Up	Observations
5. 	<b>Item</b> Scaffolding - Unguarded Openings <b>Regulation</b> #135 (1)(e) (213/91) <b>Action</b> N/A	Observed that openings in the scaffolding are guarded by a hatch and closed to ensure the safety of the worker, which meets compliance.
6. 	<b>Item</b> Fire Extinguisher - Inspection <b>Regulation</b> #55 (213/91) <b>Action</b> N/A	Observed fire extinguisher with inspection tags in place and inspections dated and signed off monthly, which meets compliance.
7. 	<b>Item</b> Drinking Water <b>Regulation</b> #28 (1) (213/91) <b>Action</b> N/A	Observed that drinking water is readily available to the workers at the project, which meets compliance.
8. 	<b>Item</b> Access / Egress - Maintenance <b>Regulation</b> #72 (213/91) <b>Action</b> On-Going	Observed access/egress routes through the work areas are clear of material/debris and other obstructions, which meets compliance.

Item #	Act / Reg / Follow-Up	Observations
9.	 <p><b>Item</b> Dust Control <b>Regulation</b> #59 (213/91) <b>Action</b> N/A</p>	Observed the work area in the school gym is sealed to prevent dust from getting into open areas around the work area, which meets compliance.
10.	 <p><b>Item</b> Housekeeping <b>Regulation</b> #35 (1) (213/91) <b>Action</b> On-Going</p>	Observed the gym work area is being adequately maintained to be free of dust and debris, which meets compliance.
11.	 <p><b>Item</b> Fencing - Public Way Protection <b>Regulation</b> #65 (213/91) <b>Action</b> Issue Corrected</p>	Observed fencing installed at least 1.8 meters in height between the project location and the public way, however an opening was observed; which endangers the public. The issue was discussed with the workers and the opening was closed and secure for the protection of public traffic, which meets compliance.
12.	 <p><b>Item</b> Guardrail System - Specs <b>Regulation</b> #26.3 (4)(1) (213/91) <b>Action</b> Supervisor</p>	Per previous report, observed the guardrail being used on site is missing a toe board. Discussed the issue with the supervisor and he shall ensure guardrails consist of a top rail, mid rail and toe board to meet compliance.



TCM - Cillian



Mike Harrison

The INSPECTOR believes the information contained within this risk assessment report to be correct at the time of reporting. The INSPECTOR does not accept responsibility for any consequences arising from the use of the information herein. The report is based on matters which were observed or came to the attention of the INSPECTOR during the day of the assessment and should not be relied upon as a final record of all possible risks or hazards that may exist or potential improvements that can be made. It is recommended that all health and safety concerns noted on this report be reviewed and addressed by the client's project Supervisor.