













Site Safety Inspection Report

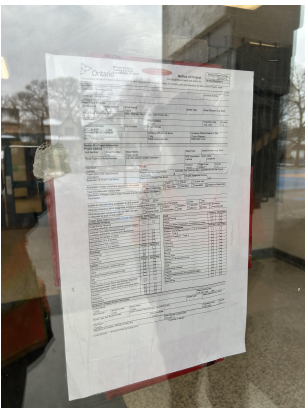

Safety Design Strategies - 410 Chrislea Road, Unit #13, Woodbridge, ON L4L 8B5 - 905-264-7233 - www.sds-safety.com

| | | | |
|--|---|-----------------------------------|---|
| Company Toronto District School Board | Location/Address 357 Runnymede Road, High Park North, Old Toronto, Toronto, Ontario, M6P 3C5, Canada | | |
| Date March 24, 2025 | Time In: 8:30 AM | Time Out: 10:30 AM | Weather Overcast Clouds, 2°C, 6 km/h Winds |
| Project | Supervisor TCM - Cillian | Safety Inspector Mike Harrison | Title TDSB Site Inspection Report for Runnymede JSPS at 357 Runnymede Rd Project Mar 24, 2025 |

| Item # | Act / Reg / Follow-Up | Observations |
|--|--|--|
| 1.  | Item Site Information INFO Regulation Site Information INFO Action N/A | SDS arrived on site at 8:30am to observe the construction work being performed at Runnymede JSPS and how the work is effecting the school and its occupants. Observed four workers on site and work consists of demolition on the roof. Discussed site conditions with TCM supervisor Cillian. |
| 2.  | Item Overhead Protection Regulation #34 (1)(a)(b) (213/91) Action N/A | Observed overhead protection provided at access and egress points of the project and above work areas where work was being performed overhead, which meets compliance. |
| 3.  | Item Scaffolding - Unguarded Openings Regulation #135 (1)(e) (213/91) Action N/A | Observed that openings in the scaffolding are guarded by a hatch and closed to ensure the safety of the worker, which meets compliance. |

| Item # | Act / Reg / Follow-Up | Observations |
|--|--|---|
| 4.  | Item Flammable Liquid Storage Regulation #43 (2) (213/91) Action N/A | Observed that flammable liquids are being stored in well ventilated areas, which meets compliance. |
| 5.  | Item Drinking Water Regulation #28 (1) (213/91) Action N/A | Observed that drinking water is readily available to the workers at the project, which meets compliance. |
| 6.  | Item Housekeeping Regulation #35 (1) (213/91) Action On-Going | Observed waste materials and debris being removed to waste disposal containment areas/bins at least daily, which meets compliance. |
| 7.  | Item Notice of Project - Ont. Reg. 213/91 Construction Projects - Section 13 Regulation Notice of Project - Ont. Reg. 213/91 Construction Projects - Section 13 Action Issue Corrected | Per previous report, observed that an updated Notice of Project is now posted in a conspicuous place on the site, which meets compliance. |
| 8.  | Item Safety Board Regulation #25 (i) OHSA Action Supervisor | Per previous report, observed a project safety board is on site that is easily accessible to the workers but is missing a piece of the required documentation/postings (certificate of first-aider). Discussed the issue with the supervisor and he shall ensure the safety board has the required documentation/postings to meet the requirements of OHSA. |

| Item # | Act / Reg / Follow-Up | Observations |
|--------|---|--|
| 9. |  <p>Item Scaffolding - Footings, Sills, Supports</p> <p>Regulation #128 (1)(c) (213/91)</p> <p>Action Issue Corrected</p> | Per previous report, observed that the footings, sills and supports of the scaffolding are now level and secure, which meets compliance. |
| 10. |  <p>Item Guardrail or Protective Covering - Openings</p> <p>Regulation #26.3 (2) (213/91)</p> <p>Action Supervisor</p> | Observed an opening in the work surface that endangers the worker. Discussed the issue with the supervisor and he shall ensure that a guardrail is in place or the opening is securely covered, adequately identified as covering an opening, is made of material that is capable of supporting all loads it may be subjected to and is capable of supporting a live load of at least 2.4 kilonewtons per square metre without exceeding the allowable unit stresses for the material used to meet compliance. |
| 11. |  <p>Item Signage</p> <p>Regulation #44 (1) (2) (213/91)</p> <p>Action N/A</p> | Observed that signage containing the word DANGER is posted in prominent areas and in sufficient numbers to warn workers and the public of the hazards on site, which meets compliance. |
| 12. |  <p>Item Guardrail System - Specs</p> <p>Regulation #26.3 (4)(1) (213/91)</p> <p>Action Supervisor</p> | Per previous report, observed the guardrail being used on site is missing a toe board. Discussed the issue with the supervisor and he shall ensure guardrails consist of a top rail, mid rail and toe board to meet compliance. |

| | |
|--|--|
|  <p>TCM - Cillian</p> |  <p>Mike Harrison</p> |
|--|--|

The INSPECTOR believes the information contained within this risk assessment report to be correct at the time of reporting. The INSPECTOR does not accept responsibility for any consequences arising from the use of the information herein. The report is based on matters which were observed or came to the attention of the INSPECTOR during the day of the assessment and should not be relied upon as a final record of all possible risks or hazards that may exist or potential improvements that can be made. It is recommended that all health and safety concerns noted on this report be reviewed and addressed by the client's project Supervisor.