











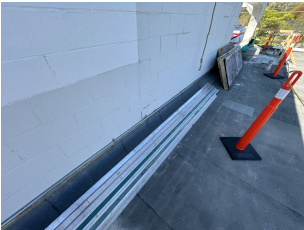
Site Safety Inspection Report



Safety Design Strategies - 410 Chrislea Road, Unit #13, Woodbridge, ON L4L 8B5 - 905-264-7233 - www.sds-safety.com

Company Toronto District School Board	Location/Address 357 Runnymede Road, High Park North, Old Toronto, Toronto, Ontario, M6P 3C5, Canada		
Date May 12, 2025	Time In: 8:30 AM	Time Out: 10:30 AM	Weather Clear Sky, 12°C, 1 km/h Winds
Project	Supervisor TCM - Cillian	Safety Inspector Mike Harrison	Title TDSB Site Inspection Report for Runnymede JSPS at 357 Runnymede Rd Project May 12, 2025

Item #	Act / Reg / Follow-Up	Observations
1. 	Item Site Information INFO Regulation Site Information INFO Action N/A	SDS arrived on site at 8:30am to observe the construction work being performed at Runnymede JSPS and how the work is effecting the school and its occupants. Discussed site conditions with Cillian. Observed four workers on site and work consists of preparation for concrete pour on the roof.
2. 	Item Scaffolding - Guardrails Regulation #135 (1)(c) (213/91) Action N/A	Observed scaffolding that had an elevation greater than 2.4 meters with adequate guardrails in place, which meets compliance.
3. 	Item Scaffolding - Footings, Sills, Supports Regulation #128 (1)(c) (213/91) Action Supervisor	Per previous report, observed that the footings, sills and supports of the scaffolding are not level and secure. Discussed the issue with the supervisor and he shall ensure that footings/sills/supports are on level ground and secured to meet compliance.
4. 	Item Step Ladder Set Up Regulation #83 (1) (213/91) Action N/A	Observed a step ladder being used on site with the legs fully extended and locked in place to prevent movement, which meets compliance.

Item #	Act / Reg / Follow-Up	Observations
5.	 <p>Item Fire Extinguisher - Flammables/Combustibles Regulation #52 (2)(a) (213/91) Action N/A</p>	Observed fire extinguishing equipment available where flammable liquids/combustibles are being stored, handled and used (i.e. compressed gas cages, propane lift trucks and mobile equipment), which meets compliance.
6.	 <p>Item Dust Control Regulation #59 (213/91) Action N/A</p>	Observed the work area is sealed to prevent dust from getting into open areas around the work area, which meets compliance.
7.	 <p>Item Material Storage Regulation #39 (213/91) Action Supervisor</p>	Observed scaffold materials on site stored in a manner which endangers the worker. Discussed the issue with the supervisor and he shall ensure all material is stored in a manner to prevent tipping, collapsing or rolling as to not endanger a worker to meet compliance.
8.	 <p>Item Access / Egress - Emergencies Regulation #71 (213/91) Action Supervisor</p>	Observed access/egress travel routes are obstructed with materials and debris. Discussed the issue with the supervisor and he shall ensure access/egress travel routes are clear of obstructions for workers to exit in the event of an emergency to meet compliance.
9.	 <p>Item Bump Lines Regulation #207 (1) (213/91) Action Supervisor</p>	Observed that a barrier has not been placed in the immediate work area with at least 2 meters from the perimeter of a roof. Discussed the issue with the supervisor and he shall ensure that adequate barriers are erected in the work area at least 2 meters from the perimeter of the roof to meet compliance.
10.	 <p>Item Fencing - Public Way Protection Regulation #65 (213/91) Action N/A</p>	Observed fencing installed at least 1.8 meters in height between the project location and the public way for the protection of public traffic, which meets compliance.

Item #	Act / Reg / Follow-Up	Observations
11. 	Item Material Storage - Openings/Edges Regulation #40 (1) (213/91) Action N/A	Observed material stored/stacked/piled at least 1.8 meters away from the open edge of a floor/roof/balcony, which meets compliance.

<div data-bbox="339 485 548 604" data-label="Text">  </div> <div data-bbox="362 611 519 640" data-label="Caption"> TCM - Cillian </div>	<div data-bbox="1073 485 1282 604" data-label="Text">  </div> <div data-bbox="1091 611 1261 640" data-label="Caption"> Mike Harrison </div>
--	--

The INSPECTOR believes the information contained within this risk assessment report to be correct at the time of reporting. The INSPECTOR does not accept responsibility for any consequences arising from the use of the information herein. The report is based on matters which were observed or came to the attention of the INSPECTOR during the day of the assessment and should not be relied upon as a final record of all possible risks or hazards that may exist or potential improvements that can be made. It is recommended that all health and safety concerns noted on this report be reviewed and addressed by the client's project Supervisor.